

## C212A Correlation Report

### General information

- Session info: <http://www3.mpifr-bonn.mpg.de/div/vlbi/globalmm/>
- Station feedback: [http://www3.mpifr-bonn.mpg.de/div/vlbi/globalmm/sessions/oct21/feedback\\_oct21.asc](http://www3.mpifr-bonn.mpg.de/div/vlbi/globalmm/sessions/oct21/feedback_oct21.asc)
- Block schedule: <https://www3.mpifr-bonn.mpg.de/div/vlbi/globalmm/sessions/oct21/MMSchedule.asc>
- Four projects: MT004A 3mm+7mm, MB016B 3mm+7mm, POLCAL1 3mm, MT004B 3mm+7mm

### Fringes

Station	Code	Fringes		Plots	Comments
		3mm	7mm		
Ef	B	yes			
Pv	P	yes			
On	X	yes			
Ys	Y	yes			
Mh	Z	yes	yes		
Br	b	yes	yes	<a href="#">No0149_7mm_b.pdf</a>	
Fd	f	yes	yes	<a href="#">No0149_7mm_f.pdf</a>	
La	l	yes	yes	<a href="#">No0149_7mm_l.pdf</a>	
Nl	n	yes	yes	<a href="#">No0149_7mm_n.pdf</a>	
Ov	o	yes	yes	<a href="#">No0149_7mm_o.pdf</a>	
Kp	k	yes	yes	<a href="#">No0149_7mm_k.pdf</a>	
Pt	p	yes	yes	<a href="#">No0149_7mm_p.pdf</a>	
Mk	m	yes	yes	<a href="#">No0149_7mm_m.pdf</a>	
Sc	c		yes	<a href="#">No0149_7mm_c.pdf</a>	
Hn	h		yes	<a href="#">No0149_7mm_h.pdf</a>	
Gb	G	no			Data corrupted (see note below). All c212a data discarded
Nn	N	yes			
Ky	y			<a href="#">No0207_3mm_KVN-Pico</a>	Very weak fringes.

Station	Code	Fringes		Plots	Comments
		3mm	7mm		
Ku	u	yes		<a href="#">No0207 3mm KVN-Pico</a>	
Kt	t	yes		<a href="#">No0207 3mm KVN-Pico</a>	

## Notes

### Data completeness

- Ef: missed scans: No0038, No0039, No0041, No0042, No0046, without comments in the log.
- Mh missed scans: No0001
- Ys: No0008 - No0014 corrupted data files
- Ky: File /data/c212a/ky/c212a\_KVNYS\_274071501.vdif VDIF summary failed with return value -5
- Kt: Kt: File /data/c212a/kt/c212a\_KVNTN\_274070001.vdif VDIF summary failed with return value -5

### NOEMA: LCP time shift

Timeserver on one of the polyfix units was not running leading to a timeshift between LCP and RCP in the beginning of the session including the fringe test. The issue was fixed on DOY 274 09:51:40.0 UT. The issue was fixed from scan No0193 onwards.

According to the NOEMA staff the issue should introduce integer second offsets of unknown value between the LCP and RCP data streams. An extensive fringe search was carried out with integer second clock offsets between -20 and +20 seconds. For scans No0001 - No0018 fringes were found at -9s offset. The time stamps of the corresponding VDIF files were shifted accordingly and fringes were found. For the following scans no matching time shift could be found and the LCP data was discarded:

No0019 - No0030

No0032, No0033, No0035 No0036 No0038 No0039

No0154 No0158 No0163 No0164 No0168 No0173 No0177 No0178 No0183 No0187

### GBT: corrupted data

Issue: Strong GBT fringes in LCP found but no detection in RCP (tested on scans 189 and 191).

**Conclusion:** (even) RCP threads apparently have been configured with the wrong thread IDs (odd LCP threads) for some portion of the session. This leads to duplicate threads even thread IDs. The extended header carries no informaton that permits to separate the correct from the incorrect threads. Even though LCP correlation has shown fringes it consists of a mixture of LCP and RCP threads. This is also reflected by the fairly large SNR in the LR cross correlations.

Problem seems to have been fixed in part c212b from scan C212B\_GB\_No0631 onwards. **All scans prior will have to be discarded.**

### Diagnostics:

```
mark6-06 INFO VDIF multiplexing statistics: nValidFrame=153
nInvalidFrame=0 nDiscardedFrame=0 nWrongThread=18421482 nSkippedByte=0
nFillByte=0 nDuplicateFrame=0 bytesProcessed=92697667320 nGoodFrame=38
```

nCall=8661

mark6-06 INFO VDIFF multiplexing statistics: nValidFrame=9938486  
nInvalidFrame=0 nDiscardedFrame=359095 nWrongThread=153 nSkippedByte=0  
nFillByte=0 nDuplicateFrame=8851360 bytesProcessed=92697667320  
nGoodFrame=2482554 nCall=23029


mark6-06 ERROR One or more wrong-threads were identified. This may indicate a correlator configuration error.  
mark6-06 ERROR One or more wrong-threads were identified. This may indicate a correlator configuration error.  
mark6-06 ERROR One or more duplicate data frames (same time and thread) were found. This may indicate serious problems with the digital back end configuration.

### Post-Correlation checks

#### Residuals

##### 3mm


##### Residuals to Kitt Peak:

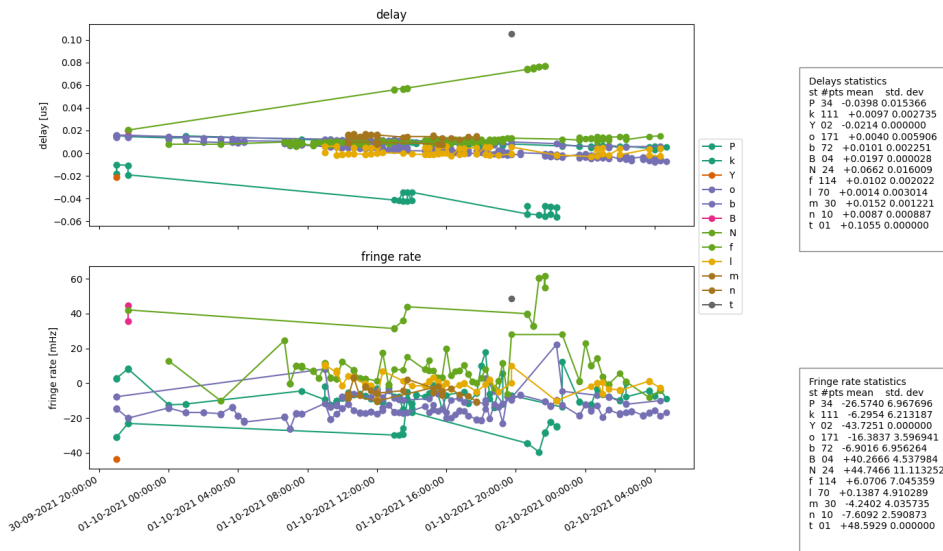

Reference station: p

Pol: LL,RR

##### Residuals to Effelsberg:

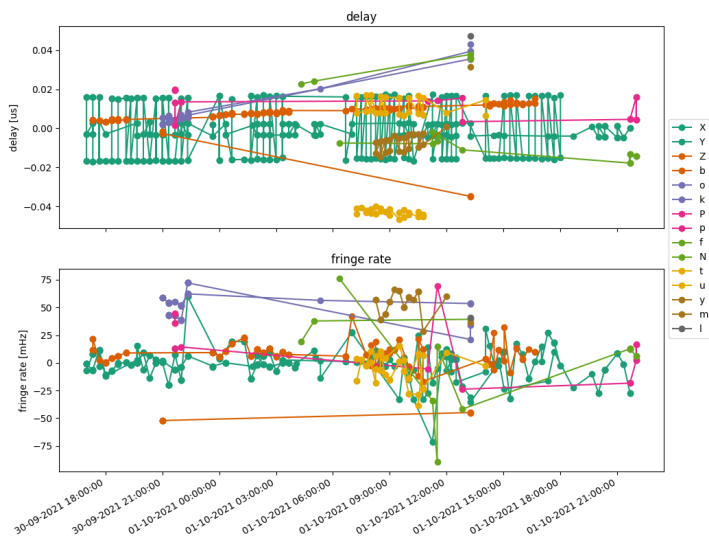

Delays statistics

st	#pts	mean	std. dev
X	155	-0.0013	0.016085
Y	125	-0.0009	0.002917
Z	114	+0.0084	0.002850
b	06	-0.0131	0.015480
o	21	+0.0093	0.011021
k	18	+0.0086	0.009720
P	16	+0.0096	0.005538
p	04	+0.0197	0.000028
f	04	+0.0302	0.006728
N	12	-0.0107	0.005062
t	24	-0.0431	0.001693
u	23	+0.0114	0.004251
y	21	-0.0073	0.004114
m	01	+0.0314	0.000000
l	01	+0.0475	0.000000


Fringe rate statistics

st	#pts	mean	std. dev
X	155	+0.8493	16.506643
Y	125	-2.2321	11.888200
Z	114	+8.8616	8.245037
b	06	-49.7884	3.410495
o	21	+56.3240	3.686429
k	18	+46.7794	14.583390
P	16	+6.2252	21.910430
p	04	+40.2666	4.537984
f	04	+34.0018	8.539771
N	12	-3.8043	39.464511
t	24	-9.0380	12.467509
u	23	+1.4606	10.754415
y	21	+52.7953	11.272260
m	01	+36.2672	0.000000
l	01	+40.6588	0.000000

Reference station: B

Pol: LL,RR

7mm  
Residuals to Kitt Peak:

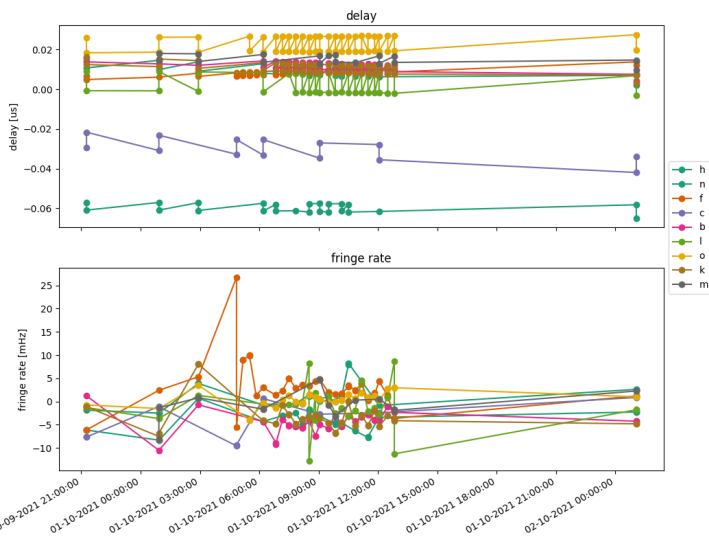

Delays statistics

st	#pts	mean	std. dev
h	24	-0.0598	0.002200
n	27	+0.0096	0.003076
f	55	+0.0087	0.001454
c	14	-0.0302	0.005369
b	45	+0.0113	0.002111
l	43	+0.0034	0.004898
o	50	+0.0229	0.003829
k	48	+0.0106	0.002527
m	18	+0.0151	0.002195

Fringe rate statistics


st	#pts	mean	std. dev
h	24	+0.8725	2.790593
n	27	-4.2496	2.374515
f	55	+2.9723	4.571654
c	14	-3.1180	3.697367
b	45	-4.3600	2.139404
l	43	-0.9491	3.675609
o	50	+0.5001	1.518828
k	48	-3.3411	2.916846
m	18	-0.3582	2.943958

Reference station: p

Pol: LL,RR


UV coverage  
3mm

UV cov.: all sources, all antennas, all pols.

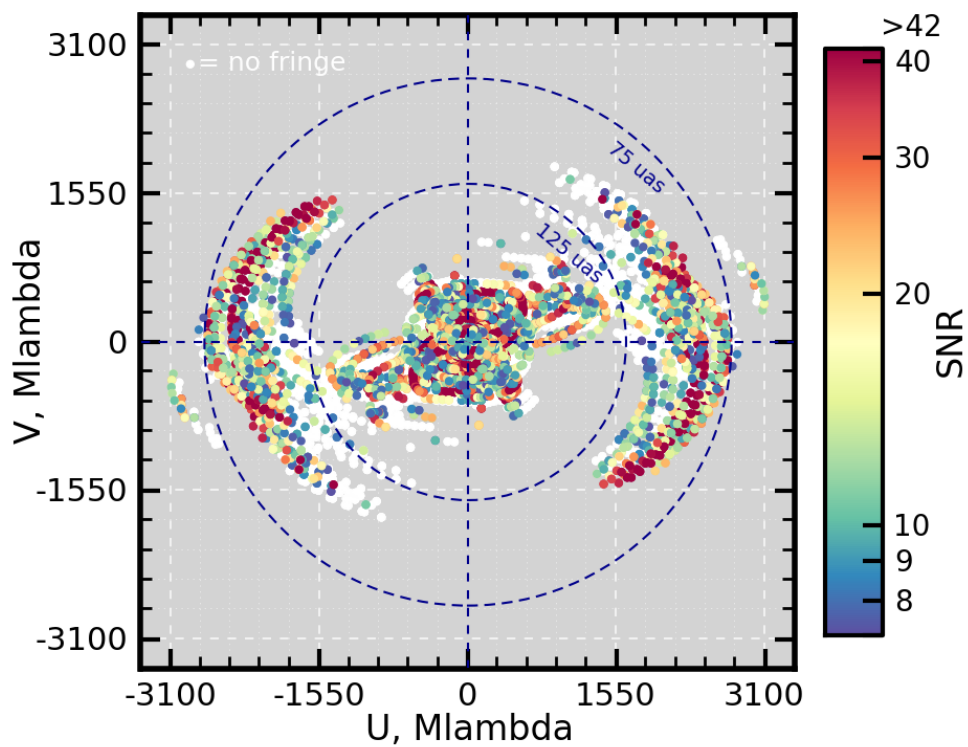

7mm

UV cov.: all sources, all antennas, all pols.

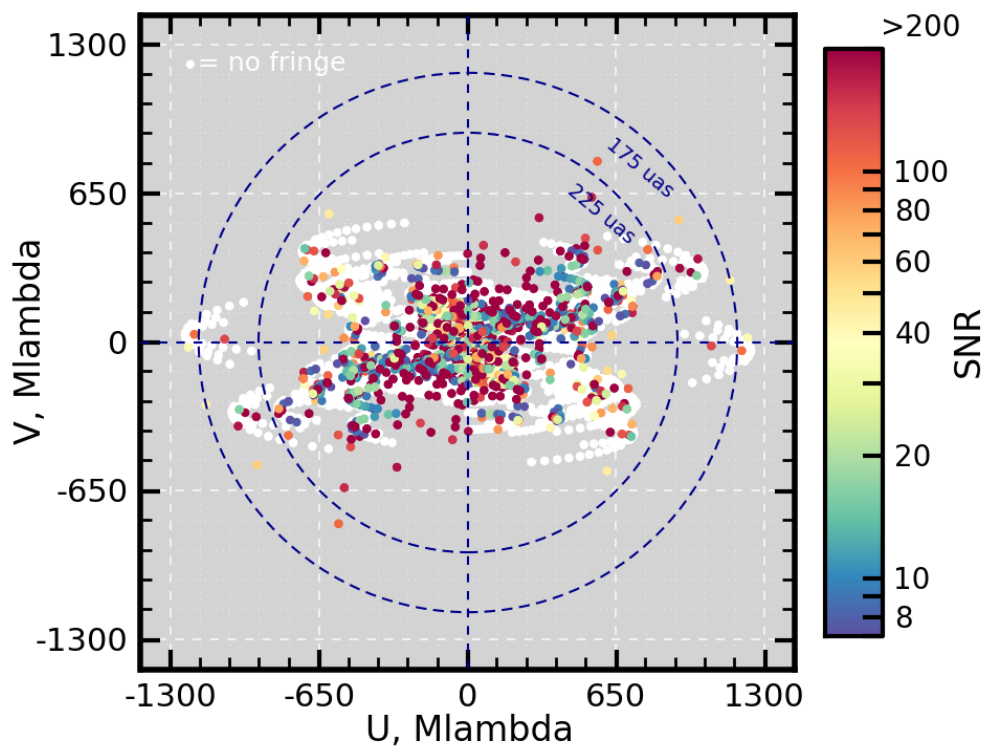

FITS completeness (pclist)

3mm

SC	MK	GB	KY	KU	KT		EF	ON	YS	PV	NN	MH	NL	FD	PT	LA	KP	OV	BR	HN
c212a_001	No0001					BLLAC 86ghz	o	o	o	o	o	x	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_002	No0002	1749+096				86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_003	No0003	1915+105				86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_004	No0004	1749+096				86ghz	o	o	88	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_005	No0005	1915+105				86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_006	No0006	1749+096				86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_007	No0007	1915+105				86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_008	No0008	1749+096				86ghz	o	o	.	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_009	No0009	1915+105				86ghz	o	o	.	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_010	No0010	1749+096				86ghz	o	o	.	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_011	No0011	1915+105				86ghz	o	o	.	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_012	No0012	3C345				86ghz	o	o	.	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_013	No0013	1749+096				86ghz	o	o	.	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_014	No0014	1915+105				86ghz	o	o	.	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_015	No0015	1749+096				86ghz	o	o	33	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_016	No0016	1915+105				86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_017	No0017	1749+096				86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_018	No0018	1915+105				86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_019	No0019	1749+096				86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_020	No0020	1915+105				86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_021	No0021	1749+096				86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_022	No0022	1915+105				86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.															
c212a_023	No0023	3C345				86ghz	o	o	o	o	o	o	o	o	o	o	o	o	o	o
.	.	.	.	.	.															

c212a_024	No0024	1915+105	86ghz	o	o	o	o	o	o	o	o	o	o	o	o	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_025	No0026	3C345	86ghz	o	o	o	o	o	o	o	o	o	o	o	o	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_026	No0027	1915+105	86ghz	o	o	o	o	o	o	o	o	o	o	o	o	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_027	No0029	3C345	86ghz	o	o	o	o	o	o	o	o	o	o	o	o	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_028	No0030	1915+105	86ghz	o	o	o	o	o	o	o	o	o	o	o	o	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_029	No0032	3C345	86ghz	o	o	o	o	o	o	o	o	o	o	o	o	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_030	No0033	1915+105	86ghz	o	o	o	o	o	o	o	o	o	o	o	o	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_031	No0035	3C345	86ghz	o	o	o	o	o	o	o	o	o	o	o	o	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_032	No0036	1915+105	86ghz	o	o	o	o	o	o	o	o	o	o	o	o	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_033	No0038	3C345	86ghz	x	o	o	o	o	o	o	o	o	o	o	o	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_034	No0039	1915+105	86ghz	x	o	o	o	o	o	o	o	o	o	o	o	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_035	No0041	3C120	86ghz	x	o	o	.	.	o	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_036	No0042	NGC1052	86ghz	x	o	o	.	.	o	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_037	No0043	1749+096	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_038	No0044	1915+105	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_039	No0046	3C120	86ghz	x	o	o	.	.	o	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_040	No0047	NGC1052	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_041	No0048	1749+096	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_042	No0049	1915+105	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_043	No0051	3C120	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_044	No0052	NGC1052	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_045	No0053	1749+096	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_046	No0054	1915+105	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_047	No0056	3C120	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_048	No0057	NGC1052	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.

c212a_049	No0058	1749+096	86ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_050	No0059	1915+105	86ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_051	No0061	3C120	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_052	No0062	NGC1052	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_053	No0063	1749+096	86ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_054	No0064	1915+105	86ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_055	No0066	0420-014	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_056	No0067	NGC1052	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_057	No0068	1749+096	86ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_058	No0069	1915+105	86ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_059	No0071	0420-014	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_060	No0072	NGC1052	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_061	No0073	3C345	86ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_062	No0074	1915+105	86ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_063	No0076	0420-014	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_064	No0077	NGC1052	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_065	No0078	1749+096	86ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_066	No0079	1915+105	86ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_067	No0081	0420-014	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_068	No0082	NGC1052	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_069	No0083	1749+096	86ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_070	No0084	1915+105	86ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_071	No0086	0420-014	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_072	No0087	NGC1052	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_073	No0088	1749+096	86ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.



c212a_074	No0089	1915+105	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_075	No0091	0420-014	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_076	No0092	NGC1052	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_077	No0093	1749+096	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_078	No0094	1915+105	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_079	No0096	0420-014	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_080	No0097	NGC1052	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_081	No0098	1749+096	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_082	No0099	1915+105	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_083	No0101	0420-014	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_084	No0102	NGC1052	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_085	No0103	3C345	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_086	No0104	1915+105	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_087	No0106	0420-014	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_088	No0107	NGC1052	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_089	No0108	1749+096	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_090	No0109	1915+105	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_091	No0111	0420-014	86ghz	o	o	o	.	.	o	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_092	No0112	NGC1052	86ghz	o	o	o	.	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_093	No0113	1749+096	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_094	No0114	1915+105	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_095	No0116	0215+015	86ghz	o	o	o	.	.	o	o	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_096	No0117	NGC1052	86ghz	o	o	o	.	.	.	o	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_097	No0118	1749+096	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_098	No0119	1915+105	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.

	No0121	3C84	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_099	No0122	0215+015	86ghz	o	o	o	.	.	o	o	o	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_100	No0123	NGC1052	86ghz	o	o	o	.	.	.	o	o	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_101	No0124	1749+096	86ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	.	.	.
.	.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_102	No0125	1915+105	86ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	.	.	.
.	.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_103	No0127	0215+015	86ghz	o	o	o	.	.	.	o	o	o	o	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_104	No0128	NGC1052	86ghz	o	o	o	.	.	.	o	o	o	o	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_105	No0130	1749+096	86ghz	.	.	.	.	.	.	.	.	.	.	o	o	o	.	.	.
.	.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_106	No0131	1915+105	86ghz	.	.	.	.	.	.	.	.	.	.	o	o	o	.	.	.
.	.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
	No0133	0420-014	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_107	No0134	0215+015	86ghz	o	o	o	.	.	.	o	o	o	o	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_108	No0135	NGC1052	86ghz	o	o	o	.	.	.	o	o	o	o	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_109	No0137	1749+096	86ghz	.	.	.	.	.	.	.	.	.	.	o	o	o	.	.	.
.	.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_110	No0138	1915+105	86ghz	.	.	.	.	.	.	.	.	.	.	o	o	o	.	.	.
.	.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_111	No0140	0215+015	86ghz	o	o	o	.	.	.	o	o	o	o	o	o	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_112	No0141	NGC1052	86ghz	o	.	o	.	.	.	o	o	o	o	o	o	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
	No0143	0420-014	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_113	No0144	0215+015	86ghz	.	.	o	.	.	.	o	o	o	o	o	o	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_114	No0145	NGC1052	86ghz	.	.	o	.	.	.	o	o	o	o	o	o	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_115	No0147	0215+015	86ghz	.	.	o	.	.	.	o	o	o	o	o	o	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_116	No0148	NGC1052	86ghz	.	.	o	.	.	.	o	o	o	o	o	o	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
	No0150	0420-014	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_117	No0151	3C120	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_118	No0152	NGC1052	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_119	No0154	OJ287	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.

```

c212a_120 No0155      3C120 86ghz . . . . . o o o o o o o .
. . x . . .
c212a_121 No0156      NGC1052 86ghz . . . . . o o o o o o o .
. . x . . .
c212a_122 No0158      OJ287 86ghz o o o o o o . . . . .
. . . . .
      No0159 0420-014 86ghz . . . . . . . . . .
. . x . . .
c212a_123 No0160      3C120 86ghz . . . . . o o o o o o o .
. . x . . .
c212a_124 No0161      NGC1052 86ghz . . . . . o o o o o o o .
. . x . . .
c212a_125 No0163      1156+295 86ghz o o o o o o . . . . .
. . . 04 o 95
c212a_126 No0164      1156+295 86ghz o o o o o o . . . . .
. . . x o o
c212a_127 No0165      3C120 86ghz . . . . . o o o o o o o .
. . x . . .
c212a_128 No0166      NGC1052 86ghz . . . . . o o o o o o o .
. o x . . .
c212a_129 No0168      1156+295 86ghz o o o o o o . . . . .
. . . 04 o o
      No0169 0420-014 86ghz . . . . . . . . . .
. . x . . .
c212a_130 No0170      3C120 86ghz . . . . . o o o o o o o .
. . x . . .
c212a_131 No0171      NGC1052 86ghz . . . . . o o o o o o o .
. o x . . .
c212a_132 No0173      1156+295 86ghz o o o o o o . . . . .
. . . x o o
c212a_133 No0174      3C120 86ghz . . . . . o o o o o o o .
. . x . . .
c212a_134 No0175      NGC1052 86ghz . . . . . o o o o o o o .
. o x . . .
c212a_135 No0177      1156+295 86ghz o o o o o o . . . . .
. . . x o o
c212a_136 No0178      1156+295 86ghz o o o o o o . . . . .
. . . o o o
      No0179 0420-014 86ghz . . . . . . . . . .
. . x . . .
c212a_137 No0180      3C120 86ghz . . . . . o o o o o o o .
. o x . . .
c212a_138 No0181      NGC1052 86ghz . . . . . o o o o o o o .
. o x . . .
c212a_139 No0183      1156+295 86ghz o o o o o o . . . . .
. . . o o o
c212a_140 No0184      3C120 86ghz . . . . . o o o o o o o .
. o x . . .
c212a_141 No0185      NGC1052 86ghz . . . . . o o o o o o o .
. o x . . .

```

c212a_142	No0187	1156+295	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.
	No0188	0420-014	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_143	No0189	0420-014	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_144	No0191	NGC1052	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_145	No0192	1156+295	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.
c212a_146	No0193	1156+295	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.
c212a_147	No0194	0420-014	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_148	No0195	NGC1052	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_149	No0197	3C345	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.
	No0198	0420-014	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_150	No0199	0420-014	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_151	No0200	NGC1052	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_152	No0202	3C345	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.
c212a_153	No0203	0420-014	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_154	No0204	NGC1052	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_155	No0206	3C345	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.
c212a_156	No0207	3C345	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.
	No0208	0420-014	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_157	No0209	0420-014	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_158	No0210	NGC1052	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_159	No0212	3C345	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.
c212a_160	No0213	0420-014	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_161	No0214	NGC1052	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_162	No0216	3C345	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.
	No0217	0420-014	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.

c212a_163	No0218	0420-014	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_164	No0219	NGC1052	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_165	No0221	3C345	86ghz	o	o	o	o	o	o	o	.	.	.	.	.	.	.
.	.	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.	.
c212a_166	No0222	3C345	86ghz	o	o	o	o	o	o	o	.	.	.	.	.	.	.
.	.	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.	.
c212a_167	No0223	0420-014	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_168	No0224	NGC1052	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_169	No0226	3C345	86ghz	o	o	o	o	o	o	o	.	.	.	.	.	.	.
.	.	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.	.
c212a_170	No0227	0420-014	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_171	No0228	NGC1052	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_172	No0230	3C345	86ghz	o	o	o	o	o	o	o	.	.	.	.	.	.	.
.	.	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.	.
c212a_173	No0231	0420-014	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_174	No0233	NGC1052	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_175	No0234	3C345	86ghz	o	o	o	o	o	o	o	.	.	.	.	.	.	.
.	.	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.	.
c212a_176	No0235	3C345	86ghz	o	o	71	o	o	o	o	.	.	.	.	.	.	.
.	.	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.	.
c212a_177	No0236	0420-014	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_178	No0237	NGC1052	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_179	No0239	3C345	86ghz	o	o	o	o	o	o	o	.	.	.	.	.	.	.
.	.	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.	.
c212a_180	No0240	0420-014	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_181	No0241	NGC1052	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_182	No0243	OJ287	86ghz	o	o	o	o	o	o	o	o	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_183	No0244	OJ287	86ghz	o	o	o	o	o	o	o	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_184	No0245	OJ287	86ghz	o	o	o	o	o	o	o	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_185	No0246	OJ287	86ghz	o	o	o	o	o	.	o	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_186	No0247	OJ287	86ghz	o	o	o	o	o	.	o	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_187	No0248	OJ287	86ghz	.	.	o	o	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.

c212a_188	No0249	BLLAC	86ghz	o	o	.	.	o	o	.	.	.	.	.	.	.	.
.	.	.	.	o	o	.	.	.	.	.	.	.	.	.	.	.	.
c212a_189	No0250	OJ287	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_190	No0251	BLLAC	86ghz	o	o	.	.	o	o	.	.	.	.	.	.	.	.
.	.	.	.	o	o	.	.	.	.	.	.	.	.	.	.	.	.
c212a_191	No0252	BLLAC	86ghz	o	o	o	.	o	o	.	.	.	.	.	.	.	.
.	.	.	.	o	o	.	.	.	.	.	.	.	.	.	.	.	.
c212a_192	No0253	OJ287	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_193	No0254	BLLAC	86ghz	o	o	o	.	o	o	.	.	.	.	.	.	.	.
.	.	.	.	o	o	.	.	.	.	.	.	.	.	.	.	.	.
c212a_194	No0255	1741-038	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_195	No0256	SS433	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_196	No0257	1055+018	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_197	No0258	OJ287	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_198	No0259	1741-038	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_199	No0260	SS433	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_200	No0261	1055+018	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_201	No0262	1741-038	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_202	No0263	SS433	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_203	No0264	OJ287	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_204	No0265	1741-038	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_205	No0266	SS433	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_206	No0267	1055+018	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_207	No0268	OJ287	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_208	No0269	1741-038	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_209	No0270	SS433	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_210	No0271	1055+018	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_211	No0272	1741-038	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_212	No0273	SS433	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.

c212a_213	No0274	OJ287	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_214	No0275	1741-038	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_215	No0276	SS433	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_216	No0277	1055+018	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_217	No0278	OJ287	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_218	No0279	1741-038	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_219	No0280	SS433	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_220	No0281	1055+018	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_221	No0282	1741-038	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_222	No0283	SS433	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_223	No0284	OJ287	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_224	No0285	1741-038	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_225	No0286	SS433	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_226	No0287	1055+018	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_227	No0288	OJ287	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_228	No0289	1741-038	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_229	No0290	SS433	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_230	No0291	1055+018	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_231	No0292	1741-038	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_232	No0293	SS433	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_233	No0294	OJ287	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	x	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.	.
c212a_234	No0295	1741-038	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_235	No0296	SS433	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_236	No0297	1055+018	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_237	No0298	OJ287	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	x	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.	.

c212a_238	No0299	1741-038	86ghz	o	o	55	o	o	.	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_239	No0300	SS433	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_240	No0301	1055+018	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	o	.
.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_241	No0302	1741-038	86ghz	o	o	o	o	o	.	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_242	No0303	SS433	86ghz	o	o	o	o	o	o	.	.	.	.	.	.	.	.	.
.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_243	No0304	OJ287	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	o	o	.
.	x	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	No0305	1741-038	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_244	No0306	1741-038	86ghz	o	o	o	o	o	.	o	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_245	No0307	SS433	86ghz	o	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_246	No0308	1055+018	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_247	No0309	OJ287	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	o	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_248	No0310	1749+096	86ghz	o	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_249	No0311	SS433	86ghz	o	o	o	o	o	o	o	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_250	No0312	1055+018	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	o	.
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	No0313	1749+096	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_251	No0314	1749+096	86ghz	o	o	o	o	o	o	o	o	o	o	o	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_252	No0315	SS433	86ghz	o	o	o	o	o	o	o	o	o	o	o	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_253	No0316	OJ287	86ghz	.	.	.	.	.	.	.	.	.	.	.	o	o	o	.
.	o	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_254	No0317	1749+096	86ghz	o	o	o	o	o	.	o	o	o	o	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_255	No0318	SS433	86ghz	o	o	o	o	o	o	o	o	o	o	o	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_256	No0319	OJ287	86ghz	.	.	.	.	.	.	.	.	.	.	.	o	o	o	.
.	o	.	o	o	o	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	No0320	1749+096	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_257	No0321	1749+096	86ghz	o	o	o	o	o	.	o	o	o	o	o	o	o	o	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_258	No0323	SS433	86ghz	o	o	o	o	o	o	o	o	o	o	o	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_259	No0324	1749+096	86ghz	o	o	o	o	o	.	o	o	o	o	o	o	o	o	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.



c212a_260	No0325	SS433	86ghz	o	o	o	o	o	o	o	o	o	o	o	o	.
.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
	No0327	1749+096	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.
.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_261	No0328	1749+096	86ghz	o	o	o	o	o	.	o	o	o	o	o	o	.
.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_262	No0329	SS433	86ghz	o	o	o	o	o	o	o	o	o	o	o	o	.
.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_263	No0331	1749+096	86ghz	.	.	o	o	.	.	o	o	o	o	o	o	.
.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_264	No0332	SS433	86ghz	o	o	o	o	o	.	o	o	o	o	o	o	.
.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
	No0334	1741-038	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.
.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_265	No0335	1741-038	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_266	No0336	SS433	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_267	No0338	1741-038	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_268	No0339	SS433	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_269	No0341	1741-038	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_270	No0342	SS433	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
	No0344	1741-038	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.
.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_271	No0345	1741-038	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_272	No0346	SS433	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_273	No0348	1741-038	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_274	No0349	SS433	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
	No0351	1741-038	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.
.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_275	No0352	1741-038	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_276	No0353	SS433	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_277	No0355	1741-038	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_278	No0356	SS433	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.
	No0358	1741-038	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.
.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_279	No0359	1741-038	86ghz	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.

c212a_280	No0361	SS433	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_281	No0362	1741-038	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_282	No0363	SS433	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
	No0365	1741-038	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_283	No0366	1741-038	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_284	No0367	SS433	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_285	No0369	1741-038	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_286	No0370	SS433	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
	No0372	1749+096	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_287	No0373	1741-038	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_288	No0374	SS433	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_289	No0376	1741-038	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_290	No0377	SS433	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
	No0379	1749+096	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_291	No0380	1749+096	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_292	No0381	SS433	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_293	No0383	1749+096	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_294	No0384	SS433	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
	No0386	2227-088	86ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.
.	.	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_295	No0387	2227-088	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_296	No0388	SS433	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_297	No0390	2227-088	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_298	No0391	SS433	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_299	No0393	2227-088	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_300	No0394	SS433	86ghz	.	.	.	.	.	.	.	o	o	o	o	o	o	.
.	o	x	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.

```

c212a_301 No0396 2227-088 86ghz . . . . . o o o o o o o .
. o x . . .
c212a_302 No0397      SS433 86ghz . . . . . o o o o o o o .
. o x . . .
  
```

**7mm**

						EF	ON	YS	PV	NN	MH	NL	FD	PT	LA	KP	OV	BR	HN
SC	MK	GB	KY	KU	KT														
c212a_01	No0025	3C345	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_02	No0028	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_03	No0031	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_04	No0034	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_05	No0037	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_06	No0040	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_07	No0045	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_08	No0050	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_09	No0055	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_10	No0060	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_11	No0065	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_12	No0070	3C345	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_13	No0075	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_14	No0080	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_15	No0085	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_16	No0090	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_17	No0095	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_18	No0100	3C345	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
.	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_19	No0105	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_20	No0110	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o
o	o	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
c212a_21	No0115	1915+105	43ghz	.	.	.	.	.	.	.	.	o	o	o	o	o	o	o	o

o o . . . .																				
c212a_22	No0120	1915+105	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . .																				
c212a_23	No0126	1915+105	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
. o . . . .																				
c212a_24	No0129	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o . . . . .																				
c212a_25	No0132	1915+105	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
. o . . . .																				
c212a_26	No0136	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o . . . . .																				
c212a_27	No0139	1915+105	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
. o . . . .																				
c212a_28	No0142	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o . . . . .																				
c212a_29	No0146	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o . . . . .																				
c212a_30	No0149	3C454.3	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . .																				
c212a_31	No0153	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o . . . . .																				
c212a_32	No0157	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o . . . . .																				
c212a_33	No0162	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o . . . . .																				
c212a_34	No0167	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . .																				
c212a_35	No0172	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . .																				
c212a_36	No0176	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . .																				
c212a_37	No0182	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . .																				
c212a_38	No0186	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . .																				
c212a_39	No0190	0420-014	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . .																				
c212a_40	No0196	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . .																				
c212a_41	No0201	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . .																				
c212a_42	No0205	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . .																				
c212a_43	No0211	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . .																				
c212a_44	No0215	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . .																				
c212a_45	No0220	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . .																				
c212a_46	No0225	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.

. o . . . . .	c212a_47	No0229	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
. o . . . . .	c212a_48	No0232	0420-014	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . . .	c212a_49	No0238	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
. o . . . . .	c212a_50	No0242	NGC1052	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
. o . . . . .	c212a_51	No0322	1749+096	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o . . . . .	c212a_52	No0326	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o . . . . .	c212a_53	No0330	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o . . . . .	c212a_54	No0333	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o . . . . .	c212a_55	No0337	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o . . . . .	c212a_56	No0340	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o . . . . .	c212a_57	No0343	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o . . . . .	c212a_58	No0347	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . . .	c212a_59	No0350	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . . .	c212a_60	No0354	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . . .	c212a_61	No0357	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . . .	c212a_62	No0360	1741-038	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . . .	c212a_63	No0364	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . . .	c212a_64	No0368	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . . .	c212a_65	No0371	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . . .	c212a_66	No0375	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . . .	c212a_67	No0378	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . . .	c212a_68	No0382	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . . .	c212a_69	No0385	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . . .	c212a_70	No0389	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.
o o . . . . .	c212a_71	No0392	SS433	43ghz	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.	.

```
o o . . . .  
c212a_72 No0395 SS433 43ghz . . . . . o o o o o o o o  
o o . . . .  
c212a_73 No0398 3C454.3 43ghz . . . . . x x x x x x x o  
o o . . . .
```